

Pims Ref	Location	Survey Document	MH From & To		Pipe Size	Pipe Mat.	Works Required	Start	Finish	Duration (per shift)
			MH	MH						
WHP1/001	The Ridings Michel Grove	<a href="#">/INCAN REPORTS/SWMH1 - S</a>	SWMH1	SWMH2	225mm	C	Defective connection at 0.5m Intrusion Cut Patch Reline x 1 Coonection Cut			1
WHP1/002	The Ridings Michel Grove	<a href="#">/INCAN REPORTS/SWMH3 - S</a>	SWMH3	SWMH6	400mm	C	Excavate and replace collapsed pipe work at 4.5m Excavation Materials			4
WHP1/003	The Ridings Madehurst Close	<a href="#">/INCAN REPORTS/SWMH9 - S</a>	SWMH9	SWMH8	225mm	C	Sewer broken at 4m Patch Reline x 1 HPWJ CCTV Survey	16-Jan-12 16-Jan-12	16-Jan-12 16-Jan-12	0.5
WHP1/004	The Ridings Kithurst Close	<a href="#">/NCAN REPORTS/SWMH12 - S</a>	SWMH12	SWMH11	225mm	C	Broken sewer at 28.2m and defective connection at 30.5m Intrusion Cut Patch Reline x 1 HPWJ CCTV Survey			1
WHP1/005	The Ridings Selbourne Way	<a href="#">/INCAN REPORTS/SWMH11 - S</a>	SWMH11	SWMH8	400mm	C	Deformed sewer and multiple fractures from 1.1m to 6.6m - excavate and replace Excavation Materials			5
WHP1/006	The Ridings Pigeonhouse Lane	<a href="#">/NCAN REPORTS/SWMH20 - S</a>	SWMH20	SWMH21	300mm	C	Broken sewer at 0.3m & 6.9m and buried manhole at 8.9m. Sond trace to located buried manhole, reline manhole to manhole. Sond Trace Reine 11m			2
WHP1/007	The Ridings Pigeonhouse Lane	<a href="#">/NCAN REPORTS/SWMH21 - S</a>	SWMH21	SWMH22	300mm	C	Circumferential fractures at 19.3m, 26m, 68.6m & 74.2m and broken sewer at 56.7m. Patch reline defects. Patch Reline x 5			2
WHP1/008	Springfiled Close Angmering Lane	<a href="#">/INCAN REPORTS/SWMH32 - S</a>	SWMH32	MAIN	150mm	C	Mass roots at 3m. High pressure root cut and re-survey. HP Root Cut CCTV Survey	10-Jan-12	10-Jan-12	0.5

Pims Ref	Location	Survey Document	MH From & To		Pipe Size	Pipe Mat.	Works Required	Start	Finish	Duration (per shift)
			MH	MH						
WHP1/009	Springfiled Close	<a href="#">WINCAN REPORTS\SWMH32</a>	SWMH32	Branch1	150mm	C	Mass roots at 2.7m, 3.4m & 7.7m. High pressure root cut and re-survey.			0.5
	Angmering Lane						HP Root Cut	10-Jan-12	10-Jan-12	
								CCTV Survey		
WHP1/010	Springfiled Close	<a href="#">NCAN REPORTS\SWMH32 - S</a>	SWMH32	SWMH31	150mm	C	Mass roots at 2m & 4.1m and light encrustation from 0.2m to 69.5m. High pressure root cut and re-survey.			0.5
	Angmering Lane						HP Root Cut	10-Jan-12	10-Jan-12	
								CCTV Survey		
WHP1/011	Pigeonhouse Lane	<a href="#">NCAN REPORTS\SWMH26 - SV</a>	SWMH26	SWMH26A	300mm	C	Circumferential crack at 40.5m and broken sewer at 41.7m. Patch reline defects.			1
	Angmering Lane						Patch Reline x 2			
WHP1/012	Michel Grove/Angmering Lane	<a href="#">WINCAN REPORTS\SWMH35 -</a>	SWMH35	MAIN	450mm	C	Broken sewer at 6.3m, multiple fractures at 6.5m, 7.6m & 12m and debris at 14m. High pressure water jet and re-survey.			0.5
	Footpath/Verge						HPWJ			
								CCTV Survey		
WHP1/013	Michel Grove/Angmering Lane	<a href="#">NCAN REPORTS\SWMH36 - S</a>	SWMH36	SWMH35	450mm	C	Sewer brokne at 2m, 6.6m, 7m & 7.1m and sewer deformed at 7.1m. Excavate and replace pipework.			5
	Footpath/Verge						Excavation			
							Materials			
							CCTV Survey			
WHP1/014	Michel Grove/Angmering Lane	<a href="#">NCAN REPORTS\SWMH35 - S</a>	SWMH35	SWMH34	450mm	C	Broken sewer at 7.3m and fractures at 7.9m, 8.5m & 13m and sewer deformed at 12.6m. Reline to 19m and re-survey			1
	Footpath/Verge						Reline			
								CCTV Survey		
WHP1/015	Cross Road	<a href="#">WINCAN REPORTS\SWMH37 -</a>	SWMH37	MAIN	150mm	C	Fractures at 4.4m and Displaced joint at 6.7m and debris. Sewer collapsed at 15.6m. High pressure water jet and re-survey.			0.5
	Footpath/Verge						HPWJ			
								CCTV Survey		
WHP1/016	Myrtle Grove	<a href="#">WINCAN REPORTS\SWMHA - S</a>	SWMHA	SWMHB	150mm	VC	Broken sewer at 23.2m and mass roots at 30.5m. Ultra high pressure root cut, patch reline at 23.2m and re-survey.			1
	Footpath/Verge						UHP Root Cut	11-Jan-12	11-Jan-12	
								Patch Reline x 1		
							CCTV Survey			

Pims Ref	Location	Survey Document	MH From & To		Pipe Size	Pipe Mat.	Works Required	Start	Finish	Duration (per shift)
			MH	MH						
WHP1/017	Myrtle Grove	<a href="#">/INCAN REPORTS\SWMHB - S</a>	SWMHB	SWMHA	150mm	VC	Large displaced joint at 1m. Excavate and replace pipe work & re-survey.			3
	Footpath/Verge						Excavation			
							Materials			
							CCTV Survey			
WHP1/018	Myrtle Grove	<a href="#">WINCAN REPORTS\SWMHB -</a>	SWMHB	MAIN	225mm	C	Mass rooys at 0.1m & 4.9m. High pressure root cut and re-survey			0.5
	Footpath/Verge						HP Root Cut	11-Jan-12	11-Jan-12	
							CCTV Survey			
<b>Manhole Section Totals</b>										29.5

Pims Ref	Location	Survey Document	MH From & To		Pipe Size	Pipe Mat.	Works Required	Start	Finish	Duration (per shift)
			MH	MH						
WHP1/019	The Ridings	<a href="#">WINCAN REPORTS\GULLY18</a>	Gully18	DS	150mm	VC	Mass roots. UHP Root cut and re-survey			1
	Angmering Lane						UHP Root Cut	11-Jan-12	11-Jan-12	
							CCTV Survey			
WHP1/020	Tamarisk Way	<a href="#">WINCAN REPORTS\GULLYA -</a>	GullyA	MAIN	100mm	C	Mass roots at 0.8m. High pressure root cut and re-survey			0.5
	Light Road						HP Root Cut			
							CCTV Survey			
WHP1/021	Cross Road/The Oaks	<a href="#">WINCAN REPORTS\GULLY21 -</a>	Gully21	Main	150mm	VC	Mass Roots at 0.9m & 1.3m. High pressure root cut and re-survey			0.5
	Light Road						HP Root Cut	12-Jan-12	12-Jan-12	
							CCTV Survey			
WHP1/022	Michel Grove/Angmering Lane	<a href="#">WINCAN REPORTS\GULLY22 -</a>	Gully22	MAIN	150mm	VC	Multiple fractures from 1.8m to 8.1m and sewer broken at 6.5m. High pressure de-scale, excavate to install one ended reline and re-survey.			1
	Light road						HP De-scale			
							Excavation			
							Reline 10m			
							CCTV Survey			
WHP1/023	Michel Grove	<a href="#">WINCAN REPORTS\GULLY26 -</a>	Gully26	Main	150mm	VC	Debris at 5m. High pressure water jetting and re-survey.			0.5
	Light Grove						HP Water Jetting	17/01/2012	17/01/2012	
							CCTV Survey			
WHP1/024	Michel Grove	<a href="#">WINCAN REPORTS\GULLY30</a>	Gully30	MAIN	150mm	VC	Multiple fractures at 3.4m and broken sewer at 9.3m. Patch reline defects and re-survey.			1
	Light Road						Patch Reline x 2 ( 1 patch 18/01)	18/01/2012		
							CCTV Survey			
WHP1/025	Michel Grove	<a href="#">WINCAN REPORTS\GULLY31 -</a>	Gully31	MAIN	150mm	VC	Broken sewer at 0.1m. Excavate and replace gully & trap, high pressure water jet & re-survey.			2
	Light Road						Excavation			
							HP Water Jetting			
							CCTV Survey			
							Materials			
WHP1/026	Myrtle Grove	<a href="#">WINCAN REPORTS\GULLY35 -</a>	Gully35	MAIN	150mm	VC	Mass roots at 2.2m. High pressure root cut and re-survey.			0.5
	Light Road						HP Root Cut	12-Jan-12	12-Jan-12	
							CCTV Survey			

Pims Ref	Location	Survey Document	MH From & To		Pipe Size	Pipe Mat.	Works Required	Start	Finish	Duration (per shift)
			MH	MH						
WHP1/027	Myrtle Grove	<a href="#">WINCAN REPORTS\GULLY39 -</a>	Gully39	MAIN	150mm	VC	Mass roots at 0.1m. High pressure root cut and re-survey.			0.5
	Light Road						HP Root Cut	12-Jan-12	12-Jan-12	
								CCTV Survey		
WHP1/028	Madehurst Close/Selbourne Way	<a href="#">WINCAN REPORTS\GULLY55 -</a>	Gully55	MAIN	150mm	VC	Encrustation medium at 4.1m and broken sewer at 5.5m. Patch reline defects and re-survey.			1
	Light Road						Patch Reline x 2	20-Jan-12	20-Jan-12	
								CCTV Survey		
WHP1/029	Selbourne Way	<a href="#">WINCAN REPORTS\GULLY64 -</a>	Gully64	MAIN	150mm	VC	Fractures at 1.2m and broken sewer at 5.7m & 6.5m. Patch reline defects and re-survey.			1
	Light Road						Patch Reline x 2	17-Jan-12	17-Jan-12	
								CCTV Survey		
WHP1/030	Kithurst Close	<a href="#">WINCAN REPORTS\GULLY70 -</a>	Gully70	MAIN	150mm	VC	Mass roots at 0.1m & 1.9m. High pressure root cut and re-survey.			0.5
	Light Road						HP Root Cut	13-Jan-12	13-Jan-12	
								CCTV Survey		
WHP1/031	West Ridings	<a href="#">WINCAN REPORTS\GULLY75 -</a>	Gully75	MAIN	150mm	VC	Sewer broken at 0.6m and encrustation heavy at 1.4m. High pressure de-scale, patch reline and re-survey			1
	Light Road						HP De-scale	19-Jan-12	19-Jan-12	
							Patch Reline	19-Jan-12	19-Jan-12	
								CCTV Survey		
WHP1/032	The Ridings	<a href="#">WINCAN REPORTS\GULLY92 -</a>	Gully92	MAIN	150mm	VC	Mass roots at 1.6m. High pressure root cut and re-survey.			0.5
	Light Road						HP Root Cut	13-Jan-12	13-Jan-12	
								CCTV Survey		
WHP1/033	West Ridings	<a href="#">WINCAN REPORTS\GULLY76 -</a>	Gully76	MAIN	150mm	VC	Broken sewer at 0.4m. Excavate & replace pipe work and re-survey.			1
	Light Road						Excavation			
								CCTV Survey		
								Materials		
WHP1/034	West Ridings	<a href="#">WINCAN REPORTS\GULLY81 -</a>	Gully78	MAIN	150mm	VC	Broken sewer at 1.1m & collapse at 3m. Excavate and replace pipe work and re-survey.			2
	Light Road						Excavation			
								CCTV Survey		
								Materials		

Pims Ref	Location	Survey Document	MH From & To		Pipe Size	Pipe Mat.	Works Required	Start	Finish	Duration (per shift)
			MH	MH						
WHP1/035	West Ridings/The Ridings	<a href="#">PHASE 1 WINCAN REPORTS\G</a>	Gully81	MAIN	150mm	VC	Sewer broken at 0.2m & 1.1m. Patch reline defect and re-survey.			0.5
	Light Road						Patch Reline x 2	16-Jan-12	17-Jan-12	
								CCTV Survey		
WHP1/036	The Ridings/The Roystons	<a href="#">WINCAN REPORTS\GULLY83 -</a>	Gully83	MAIN	150mm	VC	Broken sewer at 1m. Excavate and replace pipe work and re-survey.			2
	Light Road						Excavation			
							CCTV Survey Materials			
WHP1/037	The Roystons	<a href="#">WINCAN REPORTS\GULLY88 -</a>	Gully88	MAIN	150mm	VC	Collapse at 0.3m. Excavate and replace pipe work and re-survey.			2
	Light Road						Excavation			
							CCTV Survey Materials			
WHP1/038	The Roystons	<a href="#">WINCAN REPORTS\GULLY90 -</a>	Gully90	MAIN	150mm	VC	Fracture at 2.1m, broken joint at 3.6m & broken sewer at 4.1m. Patch reline defects and re-survey.			1
	Light Road						Patch Reline x 2	17-Jan-12	17-Jan-12	
							CCTV Survey			
WHP1/039	The Ridings	<a href="#">WINCAN REPORTS\GULLY91 -</a>	Gully91	MAIN	150mm	VC	Collapse at 1.3m. Excavate and replace pipe work and re-survey.			2
	Light Road						Excavation			
							CCTV Survey Materials			
WHP1/040	The Ridings	<a href="#">WINCAN REPORTS\GULLY93 -</a>	Gully93	MAIN	150mm	VC	Mass roots at 0.1m. High pressure root cut and re-survey.			0.5
	Light Road						HP Root Cut	13-Jan-12	13-Jan-12	
							CCTV Survey			
WHP1/041	Myrtle Grove	<a href="#">WINCAN REPORTS\GULLY 37 -</a>	Gully37	MAIN	150mm	VC	Broken sewer at 0.3m, fracture at 0.7m and large displaced joint at 1.3m. Patc reline defects and re-survey.			1
	Footpath or Verge						Patch Reline x 2	19-Jan-12	19-Jan-12	
							CCTV Survey			
WHP1/042	Myrtle Grove	<a href="#">WINCAN REPORTS\GULLY39A -</a>	Gully39A	MAIN	150mm	VC	Mass roots at 8.7m, 11m, 12.3m, 17.1m & 18.1m. High pressure root cut and re-survey.			0.5
	Light Road						HP Root Cut	17-Jan-12	17-Jan-12	
							CCTV Survey			

Pims Ref	Location	Survey Document	MH From & To		Pipe Size	Pipe Mat.	Works Required	Start	Finish	Duration (per shift)
			MH	MH						
<b>Gully Section Totals</b>										24